

Manhole Inspection Summary

Manhole # S53C__002MH

Printed On: 1/29/2009

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **53C** Node: **002** Status: **Found**

Insp Date: **6/20/08 11:06 AM**

Incomplete Comments

Crew: **dd**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **3333 e fayette st**

Cross Street: **n highland ave**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **1** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **6** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps

Count: **2** Missing: **2** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S53C__002MH

Printed On: 1/29/2009

Page 2 of 5

Location View



Top View



Miscellaneous



above grade

Defect 6




channel debris

Defect 5



bench debris

Defect 4

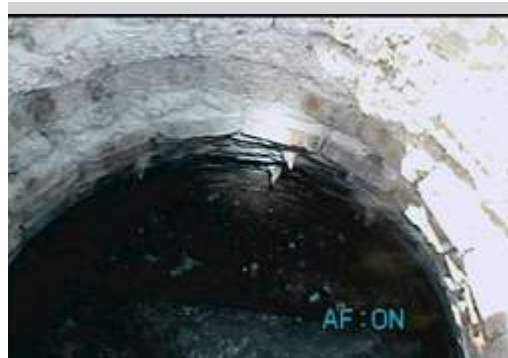

corroded and 2 missing steps

Defect 3



loose bricks and deteriorated corbel

Defect 2



chimney cond loose bricks and
deteriorated, frame adj

Manhole Inspection Summary

Manhole # S53C__002MH

Printed On: 1/29/2009

Page 4 of 5

24 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: 6.55 (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Gravel ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

12 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: 6.52 (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Gravel ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S53C__002MH

Printed On: 1/29/2009

Page 5 of 5

24 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.53** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☐ Debris ☐ Grease

Silt Depth: **4** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection